

duplication by industry and public sector agencies.

AMS is committed to complying with the E-Government Act to promote the use of the internet and other information technologies to provide increased opportunities for citizen access to Government information and services, and for other purposes.

USDA has not identified any relevant Federal rules that duplicate, overlap, or conflict with this proposed rule.

The Committee's meeting was widely publicized throughout the spearmint oil industry and all interested persons were invited to attend the meeting and participate in Committee deliberations on all issues. Like all Committee meetings, the November 6, 2013, meeting was a public meeting and all entities, both large and small, were able to express views on this issue. Finally, interested persons are invited to submit comments on this proposed rule, including the regulatory and informational impacts of this action on small businesses.

A small business guide on complying with fruit, vegetable, and specialty crop marketing agreements and orders may be viewed at: <http://www.ams.usda.gov/MarketingOrdersSmallBusinessGuide>. Any questions about the compliance guide should be sent to Jeffrey Smutny at the previously mentioned address in the **FOR FURTHER INFORMATION CONTACT** section.

A 15-day comment period is provided to allow interested persons to respond to this proposed rule. Fifteen days is deemed appropriate because: (1) The 2014–2015 fiscal period begins on June 1, 2014, and a final determination on the salable quantities and allotment percentages should be made prior to handlers purchasing from, or handling on behalf of, producers any oil for the ensuing marketing year; and (2) handlers are aware of this action, which was recommended by the Committee at a public meeting and is similar to other salable quantities and allotment percentages issued in past years.

#### List of Subjects in 7 CFR Part 985

Marketing agreements, Oils and fats, Reporting and recordkeeping requirements, Spearmint oil.

For the reasons set forth in the preamble, 7 CFR Part 985 is proposed to be amended as follows:

#### PART 985—MARKETING ORDER REGULATING THE HANDLING OF SPEARMINT OIL PRODUCED IN THE FAR WEST

■ 1. The authority citation for 7 CFR Part 985 continues to read as follows:

**Authority:** 7 U.S.C. 601–674.

■ 2. Section 985.233 is added to read as follows:

**Note:** This section will not appear in the Code of Federal Regulations.

#### § 985.233 Salable quantities and allotment percentages—2014–2015 marketing year.

The salable quantity and allotment percentage for each class of spearmint oil during the marketing year beginning on June 1, 2014, shall be as follows:

- (a) Class 1 (Scotch) oil—a salable quantity of 1,149,030 pounds and an allotment percentage of 55 percent.
- (b) Class 3 (Native) oil—a salable quantity of 1,090,821 pounds and an allotment percentage of 46 percent.

Dated: March 5, 2014.

**Rex A. Barnes,**

*Associate Administrator, Agricultural Marketing Service.*

[FR Doc. 2014–05587 Filed 3–13–14; 8:45 am]

**BILLING CODE 3410–02–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2014–0156; Directorate Identifier 2014–CE–001–AD]

RIN 2120–AA64

#### Airworthiness Directives; Costruzioni Aeronautiche Tecnam srl Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for Costruzioni Aeronautiche Tecnam srl Model P2006T airplanes. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as a cracked engine mount. We are issuing this proposed AD to require actions to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by April 28, 2014.

**ADDRESSES:** You may send comments by any of the following methods:

- Federal eRulemaking Portal: Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- Fax: (202) 493–2251.
- Mail: U.S. Department of Transportation, Docket Operations, M–

30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- Hand Delivery: U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Costruzioni Aeronautiche Tecnam Airworthiness Office, Via Maiorise–81043 Capua (CE) Italy; telephone: +39 0823 620134; fax: +39 0823 622899; email: [m.oliva@tecnam.com](mailto:m.oliva@tecnam.com) or [g.paduano@tecnam.com](mailto:g.paduano@tecnam.com); Internet: [www.tecnam.com/it-IT/documenti/service-bulletins.aspx](http://www.tecnam.com/it-IT/documenti/service-bulletins.aspx). You may review copies of the referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329–4148.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2014–0156; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

#### FOR FURTHER INFORMATION CONTACT:

Albert Mercado, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329–4119; fax: (816) 329–4090; email: [albert.mercado@faa.gov](mailto:albert.mercado@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA–2014–0156; Directorate Identifier 2014–CE–001–AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this

proposed AD because of those comments.

We will post all comments we receive, without change, to <http://regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued AD No.: 2014–0001, dated January 6, 2014 (referred to after this as “the MCAI”), to correct an unsafe condition for Costruzioni Aeronautiche Tecnam srl Model P2006T airplanes. The MCAI states:

During a “100 hours” inspection of a P2006T aeroplane, one engine mount Part Number (P/N) 26–7–1200–000 was found cracked on a node.

This condition, if not detected and corrected, could lead to engine damage, possibly resulting in damage to the aeroplane and injury to the occupants.

To address this potential unsafe condition, TECNAM issued Service Bulletin (SB) 138–CS–Rev0, providing inspection instructions.

For the reasons described above, this AD requires a one-time inspection of each engine mount P/N 26–7–1200–000 and, depending on findings, replacement of the engine mount(s).

This AD is considered an interim action and further AD action may follow.

You may examine the MCAI on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2014–0156.

### Relevant Service Information

Costruzioni Aeronautiche Tecnam srl has issued Service Bulletin No. SB 138–CS, Rev. 0, dated November 25, 2013. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

### FAA’s Determination and Requirements of the Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with this State of Design Authority, they have notified us of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all information and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design.

### Interim Action

We consider this AD interim action. We are proposing requiring inspection of the left hand and right hand engine mounts with a report to the manufacturer of the results if cracks or deformation are found. We will work with the type certificate holder to evaluate the report results to determine repetitive inspection intervals and subsequent terminating action. Based on this evaluation, we may initiate further rulemaking action to address the unsafe condition identified in this AD.

### Costs of Compliance

We estimate that this proposed AD will affect 10 products of U.S. registry. We also estimate that it would take about 6 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour.

Based on these figures, we estimate the cost of the proposed AD on U.S. operators to be \$5,100, or \$510 per product.

In addition, we estimate that any necessary follow-on actions would take about 18 work-hours and require parts costing \$1,570 (per engine mount), for a cost of \$3,100 per product. We have no way of determining the number of products that may need these actions.

### Paperwork Reduction Act

A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB control number. The control number for the collection of information required by this AD is 2120–0056. The paperwork cost associated with this AD has been detailed in the Costs of Compliance section of this document and includes time for reviewing instructions, as well as completing and reviewing the collection of information. Therefore, all reporting associated with this AD is mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at 800 Independence Ave. SW., Washington, DC 20591. ATTN: Information Collection Clearance Officer, AES–200.

### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more

detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. Amend § 39.13 by adding the following new AD:

**Costruzioni Aeronautiche Tecnam srl:**  
Docket No. FAA–2014–0156; Directorate Identifier 2014–CE–001–AD.

**(a) Comments Due Date**

We must receive comments by April 28, 2014.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Costruzioni Aeronautiche Tecnam srl Model P2006T airplanes, all serial numbers, certificated in any category.

**(d) Subject**

Air Transport Association of America (ATA) Code 71: Power Plant.

**(e) Reason**

This AD was prompted by mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as a cracked engine mount. We are issuing this AD to detect and correct cracked or deformed engine mounts, which could lead to engine damage, possibly resulting in damage to the airplane and injury to the occupants.

**(f) Actions and Compliance**

Unless already done, do the following actions as specified in paragraphs (f)(1) through (f)(3) of this AD:

(1) *For airplanes with 600 hours time-in-service (TIS) or more as of the effective date of this AD:* Within the next 25 hours TIS after the effective date of this AD or within the next 30 days after the effective date of this AD, whichever occurs first, inspect the left hand and right hand engine mounts, part number (P/N) 26-7-1200-000, for cracks and deformation following Costruzioni Aeronautiche TECNAM Service Bulletin No. SB 138-CS, Rev. 0, dated November 25, 2013.

(2) *For airplanes with less than 600 hours TIS as of the effective date of this AD:* After accumulating 600 hours TIS but before exceeding 625 hours TIS, inspect the left hand and right hand engine mounts, P/N 26-7-1200-000, for cracks and deformation following Costruzioni Aeronautiche TECNAM Service Bulletin No. SB 138-CS, Rev. 0, dated November 25, 2013.

(3) If a crack or any other deformation is found during the inspection required by paragraph (f)(1) or (f)(2) of this AD, before further flight, you must contact Costruzioni Aeronautiche Tecnam srl to obtain FAA-approved repair instructions approved specifically for compliance with this AD and incorporate those instructions. You can find contact information for Costruzioni Aeronautiche Tecnam srl in paragraph (h) of this AD. Use the occurrence report in Costruzioni Aeronautiche TECNAM Service Bulletin No. SB 138-CS, Rev. 0, dated November 25, 2013.

**(g) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, Standards Office, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to

ATTN: Albert Mercado, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4119; fax: (816) 329-4090; email: [albert.mercado@faa.gov](mailto:albert.mercado@faa.gov). Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) *Reporting Requirements:* For any reporting requirement in this AD, a federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 5 minutes per response, including the time for reviewing instructions, completing and reviewing the collection of information. All responses to this collection of information are mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at: 800 Independence Ave. SW., Washington, DC 20591, Attn: Information Collection Clearance Officer, AES-200.

**(h) Related Information**

MCAI European Aviation Safety Agency (EASA) AD No.: 2014-0001, dated January 6, 2014, for related information. You may examine the MCAI on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0156. For service information related to this AD, contact Costruzioni Aeronautiche Tecnam Airworthiness Office, Via Maiorise-81043 Capua (CE) Italy; telephone: +39 0823 620134; fax: +39 0823 622899; email: [m.oliva@tecnam.com](mailto:m.oliva@tecnam.com) or [g.paduan@tecnam.com](mailto:g.paduan@tecnam.com); Internet: [www.tecnam.com/it-IT/documenti/service-bulletins.aspx](http://www.tecnam.com/it-IT/documenti/service-bulletins.aspx). You may review this referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

Issued in Kansas City, Missouri, on March 7, 2014.

**Steven W. Thompson,**

*Acting Manager, Small Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2014-05612 Filed 3-13-14; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 71**

[Docket No. FAA-2013-0986; Airspace Docket No. 13-AGL-25]

**Proposed Establishment of Class E Airspace; Bois Blanc Island, MI**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This action proposes to establish Class E airspace at Bois Blanc Island, MI. Controlled airspace is necessary to accommodate new Standard Instrument Approach Procedures (SIAP) at Bois Blanc Island Airport. The FAA is taking this action to enhance the safety and management of Instrument Flight Rules (IFR) operations for SIAPs at the airport.

**DATES:** Comments must be received on or before April 28, 2014.

**ADDRESSES:** Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, 1200 New Jersey Avenue SE., West Building Ground Floor, Room W12-140, Washington, DC 20590-0001. You must identify the docket number FAA-2013-0986/Airspace Docket No. 13-AGL-25, at the beginning of your comments. You may also submit comments through the Internet at <http://www.regulations.gov>. You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Dockets Office between 9:00 a.m. and 5:00 p.m., Monday through Friday, except Federal holidays. The Docket Office (telephone 1-800-647-5527), is on the ground floor of the building at the above address.

**FOR FURTHER INFORMATION CONTACT:** Raul Garza, Jr., Central Service Center, Operations Support Group, Federal Aviation Administration, Southwest Region, 2601 Meacham Blvd., Fort Worth, TX 76137; telephone: 817-321-7654.

**SUPPLEMENTARY INFORMATION:****Comments Invited**

Interested parties are invited to participate in this proposed rulemaking by submitting such written data, views, or arguments, as they may desire. Comments that provide the factual basis supporting the views and suggestions presented are particularly helpful in developing reasoned regulatory decisions on the proposal. Comments are specifically invited on the overall