

**Other FAA AD Provisions**

(h) The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-1137; fax (425) 227-1149. Before using any approved AMOC on any airplane to which the AMOC applies, notify your principal maintenance inspector (PMI) or principal avionics inspector (PAI), as appropriate, or lacking a principal inspector, your local Flight Standards District Office. The AMOC approval letter must specifically reference this AD.

(2) Airworthy Product: For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) Reporting Requirements: A Federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 5 minutes per response, including the time for reviewing instructions, completing and reviewing the collection of information. All responses to this collection of information are mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at: 800 Independence Ave, SW., Washington, DC 20591, Attn: Information Collection Clearance Officer, AES-200.

**Related Information**

(i) Refer to MCAI European Aviation Safety Agency (EASA) Airworthiness Directive 2010-0032, dated March 3, 2010; and Dassault Mandatory Service Bulletin 7X-104, dated October 30, 2009; for related information.

**Material Incorporated by Reference**

(j) You must use Dassault Mandatory Service Bulletin 7X-104, dated October 30, 2009, to do the actions required by this AD, unless the AD specifies otherwise.

(1) The Director of the Federal Register approved the incorporation by reference of this service information under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) For service information identified in this AD, contact Dassault Falcon Jet, P.O. Box 2000, South Hackensack, New Jersey 07606;

telephone 201-440-6700; Internet <http://www.dassaultfalcon.com>.

(3) You may review copies of the service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington. For information on the availability of this material at the FAA, call 425-227-1221.

(4) You may also review copies of the service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

Issued in Renton, Washington, on November 5, 2010.

**Jeffrey E. Duven,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2010-28938 Filed 11-23-10; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2010-1155; Directorate Identifier 2010-NM-238-AD; Amendment 39-16527; AD 2010-24-08]**

**RIN 2120-AA64**

**Airworthiness Directives; DASSAULT AVIATION Model MYSTERE-FALCON 50 Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule; request for comments.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for the products listed above. This AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

On two occurrences on Mystère-Falcon 50 aeroplanes in service, it was detected that two pipes of the emergency brake system #2 located near the nose landing gear bearing were swapped.

The swapping of these two pipes implies that when the Left Hand (LH) brake pedal is depressed, the Right Hand (RH) brake unit is activated, and conversely, when the RH brake pedal is depressed, the LH brake unit is actuated. This constitutes an unsafe condition, which may go unnoticed as the condition is latent until the emergency brake system #2 is used. This condition, if not

corrected, could ultimately lead to a runway excursion of the aeroplane.

\* \* \* \* \*

This AD requires actions that are intended to address the unsafe condition described in the MCAI.

**DATES:** This AD becomes effective December 9, 2010.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in the AD as of December 9, 2010.

We must receive comments on this AD by January 10, 2011.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.
- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-40, 1200 New Jersey Avenue, SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-1137; fax (425) 227-1149.

**SUPPLEMENTARY INFORMATION:****Discussion**

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA Emergency Airworthiness Directive 2010-0208-E, dated October 12, 2010 (referred to after this as "the MCAI"), to correct an unsafe condition for the specified products. The MCAI states:

On two occurrences on Mystère-Falcon 50 aeroplanes in service, it was detected that

two pipes of the emergency brake system #2 located near the nose landing gear bearing were swapped.

The swapping of these two pipes implies that when the Left Hand (LH) brake pedal is depressed, the Right Hand (RH) brake unit is activated, and conversely, when the RH brake pedal is depressed, the LH brake unit is actuated. This constitutes an unsafe condition, which may go unnoticed as the condition is latent until the emergency brake system #2 is used. This condition, if not corrected, could ultimately lead to a runway excursion of the aeroplane.

For the reasons described above, this [EASA] AD requires an [general visual] inspection of the main landing gear braking system and, in case of findings, proper re-installation of the emergency brake system #2 pipes. This [EASA] AD also requires painting the affected pipes for clear identification in order to avoid mistakes while reinstalling them after maintenance.

You may obtain further information by examining the MCAI in the AD docket.

#### Relevant Service Information

DASSAULT AVIATION has issued Service Bulletin F50–515, dated October 12, 2010. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

#### FAA's Determination and Requirements of this AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are issuing this AD because we evaluated all pertinent information and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design.

#### Differences Between the AD and the MCAI or Service Information

We have reviewed the MCAI and related service information and, in general, agree with their substance. But we might have found it necessary to use different words from those in the MCAI to ensure the AD is clear for U.S. operators and is enforceable. In making these changes, we do not intend to differ substantively from the information provided in the MCAI and related service information.

We might also have required different actions in this AD from those in the MCAI in order to follow FAA policies. Any such differences are highlighted in a Note within the AD.

#### FAA's Determination of the Effective Date

An unsafe condition exists that requires the immediate adoption of this AD. The FAA has found that the risk to the flying public justifies waiving notice and comment prior to adoption of this rule because this unsafe condition could result in a high speed runway excursion when the brakes are applied. Therefore, we determined that notice and opportunity for public comment before issuing this AD are impracticable and that good cause exists for making this amendment effective in fewer than 30 days.

#### Comments Invited

This AD is a final rule that involves requirements affecting flight safety, and we did not precede it by notice and opportunity for public comment. We invite you to send any written relevant data, views, or arguments about this AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA–2010–1155; Directorate Identifier 2010–NM–238–AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this AD. We will consider all comments received by the closing date and may amend this AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this AD.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this AD:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD and placed it in the AD docket.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

- Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended].

- 2. The FAA amends § 39.13 by adding the following new AD:

#### 2010–24–08 Dassault Aviation:

Amendment 39–16527. Docket No. FAA–2010–1155; Directorate Identifier 2010–NM–238–AD.

#### Effective Date

(a) This airworthiness directive (AD) becomes effective December 9, 2010.

#### Affected ADs

(b) None.

#### Applicability

(c) This AD applies to DASSAULT AVIATION Model MYSTERE–FALCON 50 airplanes, certificated in any category, all serial numbers.

#### Subject

(d) Air Transport Association (ATA) of America Code 32: Landing Gear.

#### Reason

(e) The mandatory continued airworthiness information (MCAI) states:

On two occurrences on Mystère-Falcon 50 aeroplanes in service, it was detected that two pipes of the emergency brake system #2 located near the nose landing gear bearing were swapped.

The swapping of these two pipes implies that when the Left Hand (LH) brake pedal is depressed, the Right Hand (RH) brake unit is activated, and conversely, when the RH brake pedal is depressed, the LH brake unit is actuated. This constitutes an unsafe condition, which may go unnoticed as the condition is latent until the emergency brake system #2 is used. This condition, if not corrected,

\* \* \* \* \*

#### Compliance

(f) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

#### Actions

(g) Within 7 days after the effective date of this AD, do a general visual inspection for correct installation (as defined in Dassault Service Bulletin F50-515, dated October 12, 2010) of the emergency brake system number 2, in accordance with the Accomplishment Instructions of Dassault Service Bulletin F50-515, dated October 12, 2010, except that work required by this AD can only be done by persons prescribed in 14 CFR 43.3 and 43.7.

(h) If the emergency brake system number 2 is found installed incorrectly during the inspection required by paragraph (g) of this AD: Before further flight, install the emergency brake system number 2 correctly, in accordance with the Accomplishment Instructions of Dassault Service Bulletin F50-515, dated October 12, 2010.

#### FAA AD Differences

**Note 1:** This AD differs from the MCAI and/or service information as follows:

(1) European Aviation Safety Agency (EASA) AD 2010-0208-E, dated October 12, 2010, has a compliance time of "before the next flight after the effective date of this AD." This AD requires that the actions be done within 7 days after the effective date of this AD.

(2) EASA AD 2010-0208-E, dated October 12, 2010, allows the flightcrew to inspect the emergency brake system number 2 specified in accordance with Dassault Service Bulletin F50-515, dated October 12, 2010. However, this AD requires the inspection to be performed by certificated maintenance personnel.

(3) EASA AD 2010-0208-E, dated October 12, 2010, requires painting the pipes end of the emergency brake system number 2 and related unions within 7 months after the effective date of that AD. This AD does not require painting the pipes end of the emergency brake system number 2 and related unions. We might consider additional rulemaking to require this action in the future.

#### Other FAA AD Provisions

(i) The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-1137; fax (425) 227-1149. Before using any approved AMOC on any airplane to which the AMOC applies, notify your principal maintenance inspector (PMI) or principal avionics inspector (PAI), as appropriate, or lacking a principal inspector, your local Flight Standards District Office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) *Reporting Requirements:* For any reporting requirement in this AD, under the provisions of the Paperwork Reduction Act (44 U.S.C. 3501 *et seq.*), the Office of Management and Budget (OMB) has approved the information collection requirements and has assigned OMB Control Number 2120-0056.

#### Related Information

(j) Refer to MCAI EASA AD 2010-0208-E, dated October 12, 2010; and Dassault Service Bulletin F50-515, dated October 12, 2010; for related information.

#### Material Incorporated by Reference

(k) You must use Dassault Service Bulletin F50-515, dated October 12, 2010, to do the actions required by this AD, unless the AD specifies otherwise.

(1) The Director of the Federal Register approved the incorporation by reference of this service information under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) For service information identified in this AD, contact Dassault Falcon Jet, P.O. Box 2000, South Hackensack, New Jersey 07606; telephone 201-440-6700; Internet <http://www.dassaultfalcon.com>.

(3) You may review copies of the service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington. For information on the availability of this material at the FAA, call 425-227-1221.

(4) You may also review copies of the service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

Issued in Renton, Washington on November 15, 2010.

**Ali Bahrami,**

Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2010-29458 Filed 11-23-10; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2010-0711; Directorate Identifier 2008-SW-25-AD; Amendment 39-16521; AD 2010-24-03]

**RIN 2120-AA64**

#### **Airworthiness Directives; Robinson Helicopter Company (Robinson) Model R22, R22 Alpha, R22 Beta, and R22 Mariner Helicopters, and Model R44, and R44 II Helicopters**

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Final rule.

**SUMMARY:** This amendment adopts a new airworthiness directive (AD) for Robinson Model R22, R22 Alpha, R22 Beta, and R22 Mariner helicopters, and Model R44 and R44 II helicopters. This AD requires visually inspecting each tail rotor (T/R) control pedal bearing block support (support) for a crack, measuring the thickness of each support, installing support safety tabs on certain supports, and replacing supports of a certain thickness during the next 2,200 hour overhaul. This amendment is prompted by two reports of Model R22 helicopters experiencing broken supports during flight, which resulted in the T/R control pedals becoming jammed. The actions specified by this AD are intended to prevent the supports from breaking, which can bind the T/R control pedals, resulting in a reduction of yaw control and subsequent loss of control of the helicopter.

**DATES:** Effective December 29, 2010.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of December 29, 2010.

**ADDRESSES:** You may get the service information identified in this AD from Robinson Helicopter Company, 2901 Airport Drive, Torrance, California 90505, telephone (310) 539-0508, fax (310) 539-5198.

*Examining the Docket:* You may examine the docket that contains this AD, any comments, and other information on the Internet at <http://www.faa.gov/docket>.