

TABLE 2—PREVIOUSLY ISSUED SERVICE INFORMATION

| Boeing—  | Revision—      | Dated—          |
|--|----------------|-----------------|
| Alert Service Bulletin 737–24A1166 .....             | 3 .....        | July 25, 2007.  |
| Special Attention Service Bulletin 757–24–0110 ..... | Original ..... | April 28, 2005. |
| Special Attention Service Bulletin 757–24–0111 ..... | Original ..... | April 28, 2005. |

**Note 1:** The Boeing service bulletins specified in Table 1 of this AD refer to Avionic Instruments Inc. Service Bulletins 1–002–0102–1000–24–28, Revision A, dated June 22, 2005; and Revision B, dated July 24, 2006; as additional sources of guidance for accomplishing the modification required by paragraph (f) of this AD.

#### Alternative Methods of Compliance

(i)(1) The Manager, Seattle Aircraft Certification Office (ACO), FAA, has the

authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Binh V. Tran, Aerospace Engineer, Systems and Equipment Branch, ANM–130S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue, SW., Renton, Washington 98057–3356; telephone (425) 917–6485; fax (425) 917–6590. Or, e-mail information to 9–ANM–Seattle-ACO-AMOC-Requests@faa.gov.

(2) To request a different method of compliance or a different compliance time for this AD, follow the procedures in 14 CFR 39.19. Before using any approved AMOC on

any airplane to which the AMOC applies, notify your principal maintenance inspector (PMI) or principal avionics inspector (PAI), as appropriate, or lacking a principal inspector, your local Flight Standards District Office. The AMOC approval letter must specifically reference this AD.

#### Material Incorporated by Reference

(j) You must use the applicable Boeing service information contained in Table 3 of this AD to do the actions required by this AD, unless the AD specifies otherwise.

TABLE 3—MATERIAL INCORPORATED BY REFERENCE

| Boeing—  | Revision—      | Dated—            |
|--|----------------|-------------------|
| Alert Service Bulletin 737–24A1166 .....             | 4 .....        | May 21, 2009.     |
| Service Bulletin 747–24–2254 .....                   | 1 .....        | March 5, 2007.    |
| Service Bulletin 777–24–0095 .....                   | 1 .....        | January 3, 2007.  |
| Special Attention Service Bulletin 737–24–1165 ..... | 1 .....        | October 20, 2005. |
| Special Attention Service Bulletin 757–24–0110 ..... | 1 .....        | August 6, 2009.   |
| Special Attention Service Bulletin 757–24–0111 ..... | 1 .....        | August 6, 2009.   |
| Special Attention Service Bulletin 767–24–0160 ..... | Original ..... | June 30, 2005.    |
| Special Attention Service Bulletin 767–24–0161 ..... | Original ..... | June 30, 2005.    |

(1) The Director of the Federal Register approved the incorporation by reference of this service information under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P. O. Box 3707, MC 2H–65, Seattle, Washington 98124–2207; telephone 206–544–5000, extension 1, fax 206–766–5680; e-mail [me.boecom@boeing.com](mailto:me.boecom@boeing.com); Internet <https://www.myboeingfleet.com>.

(3) You may review copies of the service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington. For information on the availability of this material at the FAA, call 425–227–1221 or 425–227–1152.

(4) You may also review copies of the service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202–741–6030, or go to: [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

Issued in Renton, Washington, on December 4, 2009.

**Michael J. Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. E9–29963 Filed 12–24–09; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

**[Docket No. FAA–2009–1209; Directorate Identifier 2009–NM–151–AD; Amendment 39–16147; AD 2008–04–11 R1]**

**RIN 2120–AA64**

#### **Airworthiness Directives; The Boeing Company Model 707 Airplanes, and Model 720 and 720B Series Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule; request for comments.

**SUMMARY:** The FAA is revising an existing airworthiness directive (AD), which applies to all Model 707 airplanes, and Model 720 and 720B series airplanes. That AD currently requires revising the FAA-approved maintenance program by incorporating new airworthiness limitations (AWLs) for fuel tank systems to satisfy Special Federal Aviation Regulation No. 88 requirements. That AD also requires an initial inspection to phase in certain repetitive AWL inspections, and repair

if necessary. This AD clarifies the intended effect of the AD on spare and on-airplane fuel tank system components. This AD results from design review of the fuel tank systems. We are issuing this AD to prevent the potential for ignition sources inside fuel tanks caused by latent failures, alterations, repairs, or maintenance actions, which, in combination with flammable fuel vapors, could result in fuel tank explosions and consequent loss of the airplane.

**DATES:** This AD is effective January 12, 2010.

On March 28, 2008 (73 FR 9666, February 22, 2008), the Director of the Federal Register approved the incorporation by reference of a certain publication listed in the AD.

We must receive any comments on this AD by February 11, 2010.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

• **Hand Delivery:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, Washington 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; e-mail [me.boecom@boeing.com](mailto:me.boecom@boeing.com); Internet <https://www.myboeingfleet.com>.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

#### FOR FURTHER INFORMATION CONTACT:

Thomas Thorson, Aerospace Engineer, Propulsion Branch, ANM-140S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 917-6508; fax (425) 917-6590.

#### SUPPLEMENTARY INFORMATION:

##### Discussion

On February 13, 2008, we issued AD 2008-04-11, Amendment 39-15383 (73 FR 9666, February 22, 2008). That AD applied to all Model 707 airplanes, and Model 720 and 720B series airplanes. That AD required revising the FAA-approved maintenance program by incorporating new airworthiness limitations (AWLs) for fuel tank systems to satisfy Special Federal Aviation Regulation No. 88 requirements. That AD also required an initial inspection to phase in certain repetitive AWL inspections, and repair if necessary. That AD resulted from a design review of the fuel tank systems. The actions specified in that AD are intended to prevent the potential for ignition sources inside fuel tanks caused by latent failures, alterations, repairs, or maintenance actions, which, in combination with flammable fuel vapors, could result in fuel tank explosions and consequent loss of the airplane.

Critical design configuration control limitations (CDCCLs) are limitation

requirements to preserve a critical ignition source prevention feature of the fuel tank system design that is necessary to prevent the occurrence of an unsafe condition. The purpose of a CDCCL is to provide instruction to retain the critical ignition source prevention feature during configuration change that may be caused by alterations, repairs, or maintenance actions. A CDCCL is not a periodic inspection.

#### Actions Since AD was Issued

Since we issued that AD, we have determined that it is necessary to clarify the AD's intended effect on spare and on-airplane fuel tank system components, regarding the use of maintenance manuals and instructions for continued airworthiness.

Section 91.403(c) of the Federal Aviation Regulations (14 CFR 91.403(c)) specifies the following:

No person may operate an aircraft for which a manufacturer's maintenance manual or instructions for continued airworthiness has been issued that contains an airworthiness limitation section unless the mandatory \* \* \* procedures \* \* \* have been complied with.

Some operators have questioned whether existing components affected by the new CDCCLs must be reworked. We did not intend for the AD to retroactively require rework of components that had been maintained using acceptable methods before the effective date of the AD. Owners and operators of the affected airplanes therefore are not required to rework affected components identified as airworthy or installed on the affected airplanes before the required revisions of the FAA-approved maintenance program. But once the CDCCLs are incorporated into the FAA-approved maintenance program, future maintenance actions on components must be done in accordance with those CDCCLs.

#### FAA's Determination and Requirements of This AD

The unsafe condition described previously is likely to exist or develop on other airplanes of the same type design. For this reason, we are issuing this AD to revise AD 2008-04-11. This new AD retains the requirements of the existing AD, and adds a new note to clarify the intended effect of the AD on spare and on-airplane fuel tank system components.

#### Explanation of Additional Changes to AD

AD 2008-04-11 allowed the use of later revisions of the airworthiness limitations. That provision has been

removed from this AD. Allowing the use of "a later revision" of specific service documents violates Office of the Federal Register regulations for approving materials that are incorporated by reference. Affected operators, however, may request approval to use a later revision of the referenced service documents as an alternative method of compliance, under the provisions of paragraph (j) of this AD.

In addition, we have revised this AD to identify the legal name of the manufacturer as published in the most recent type certificate data sheet for the affected airplane models.

#### Costs of Compliance

This revision imposes no additional economic burden. The current costs for this AD are repeated for the convenience of affected operators, as follows:

There are about 213 airplanes of the affected design in the worldwide fleet. This AD affects about 76 airplanes of U.S. registry. The required actions take about 8 work hours per airplane, at an average labor rate of \$80 per work hour. Based on these figures, the estimated cost of the AD for U.S. operators is \$48,640, or \$640 per airplane.

#### FAA's Justification and Determination of the Effective Date

This revision merely clarifies the intended effect on spare and on-airplane fuel tank system components, and makes no substantive change to the AD's requirements. For this reason, it is found that notice and opportunity for prior public comment for this action are unnecessary, and good cause exists for making this amendment effective in less than 30 days.

#### Comments Invited

This AD is a final rule that involves requirements affecting flight safety, and we did not provide you with notice and an opportunity to provide your comments before it becomes effective. However, we invite you to send any written data, views, or arguments about this AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2009-1209; Directorate Identifier 2009-NM-151-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this AD. We will consider all comments received by the closing date and may amend this AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any

personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this AD.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in subtitle VII, part A, subpart III, section 44701, "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We have determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

*For the reasons discussed above, I certify that the regulation:*

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD and placed it in the AD docket. See the **ADDRESSES** section for a location to examine the regulatory evaluation.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

■ Accordingly, under the authority delegated to me by the Administrator, the FAA amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by removing Amendment 39–15383 (73 FR 9666, February 22, 2008) and adding the following new AD:

**2008–04–11 R1 The Boeing Company:**  
Amendment 39–16147. Docket No. FAA–2009–1209; Directorate Identifier 2009–NM–151–AD.

#### Effective Date

- (a) This airworthiness directive (AD) is effective January 12, 2010.

#### Affected ADs

- (b) This AD revises AD 2008–04–11, Amendment 39–15383.

#### Applicability

- (c) This AD applies to all The Boeing Company Model 707–100 long body, –200, –100B long body, and –100B short body series airplanes; Model 707–300, –300B, –300C, and –400 series airplanes; and Model 720 and 720B series airplanes; certificated in any category.

**Note 1:** This AD requires revisions to certain operator maintenance documents to include new inspections. Compliance with these inspections is required by 14 CFR 91.403(c). For airplanes that have been previously modified, altered, or repaired in the areas addressed by these limitations, the operator may not be able to accomplish the actions described in the revisions. In this situation, to comply with 14 CFR 91.403(c), the operator must request approval for an alternative method of compliance according to paragraph (j) of this AD. The request should include a description of changes to the required inspections that will ensure the continued operational safety of the airplane.

#### Unsafe Condition

- (d) This AD results from a design review of the fuel tank systems. We are issuing this AD to prevent the potential for ignition sources inside fuel tanks caused by latent failures, alterations, repairs, or maintenance actions, which, in combination with flammable fuel vapors, could result in fuel tank explosions and consequent loss of the airplane.

#### Compliance

- (e) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

#### Restatement of Requirements of AD 2008–04–11, With Changes to Compliance Method

#### Service Information

- (f) The term "D6–7552–AWL March 2006," as used in this AD, means Boeing 707/720 Airworthiness Limitations (AWLs) Document D6–7552–AWL, dated March 2006.

#### Revision of AWLs Section

- (g) Before December 16, 2008, revise the FAA-approved maintenance program by incorporating the information in the sections specified in paragraphs (g)(1) through (g)(3) of this AD, except that the initial inspection specified in paragraph (h) of this AD must be done at the time specified in paragraph (h).

(1) Section B., "FUEL SYSTEMS AIRWORTHINESS LIMITATIONS," of D6–7552–AWL March 2006.

(2) Section C., "SYSTEM AWL PAGE FORMAT," of D6–7552–AWL March 2006.

(3) Section D., "AIRWORTHINESS LIMITATIONS—FUEL SYSTEMS," of D6–7552–AWL March 2006.

#### Initial Inspection and Repair if Necessary

- (h) At the later of the times specified in paragraphs (h)(1) and (h)(2) of this AD: Do a detailed inspection of external wires over the center fuel tank for damaged or loose clamps, wire chafing, and wire bundles in contact with the surface of the center fuel tank, in accordance with Section D, "AIRWORTHINESS LIMITATIONS—FUEL SYSTEMS," AWL 28–AWL–01, of D6–7552–AWL March 2006. If any discrepancy is found during this inspection, repair the discrepancy before further flight in accordance with D6–7552–AWL March 2006. Accomplishing AWL 28–AWL–01 as part of an FAA-approved maintenance program prior to the later of the times specified in paragraphs (h)(1) and (h)(2) of this AD constitutes compliance with the requirements of this paragraph.

(1) Before the accumulation of 36,000 total flight cycles, or within 120 months since the date of issuance of the original standard airworthiness certificate or the date of issuance of the original export certificate of airworthiness, whichever occurs first.

(2) Within 72 months after March 28, 2008 (the effective date of AD 2008–04–11).

**Note 2:** For the purposes of this AD, a detailed inspection is: "An intensive examination of a specific item, installation, or assembly to detect damage, failure, or irregularity. Available lighting is normally supplemented with a direct source of good lighting at an intensity deemed appropriate. Inspection aids such as mirror, magnifying lenses, etc., may be necessary. Surface cleaning and elaborate procedures may be required."

#### No Alternative Inspections, Inspection Intervals, or Critical Design Configuration Control Limitations (CDCCLs)

- (i) After accomplishing the actions specified in paragraphs (g) and (h) of this AD, no alternative inspections, inspection intervals, or CDCCLs may be used unless the inspections, intervals, or CDCCLs are approved as an alternative method of compliance (AMOC) in accordance with the procedures specified in paragraph (j) of this AD.

#### New Information

#### Explanation of CDCCL Requirements

**Note 3:** Notwithstanding any other maintenance or operational requirements, components that have been identified as

airworthy or installed on the affected airplanes before the revision of the FAA-approved maintenance program, as required by paragraph (g) of this AD, do not need to be reworked in accordance with the CDCCLs. However, once the FAA-approved maintenance program has been revised, future maintenance actions on these components must be done in accordance with the CDCCLs.

#### Alternative Methods of Compliance (AMOCs)

(j)(1) The Manager, Seattle Aircraft Certification Office (SACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Thomas Thorson, Aerospace Engineer, Propulsion Branch, ANM-140S, FAA, SACO, 1601 Lind Avenue SW., Renton, Washington 98057-3356; telephone (425) 917-6508; fax (425) 917-6590. Or, e-mail information to [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) To request a different method of compliance or a different compliance time for this AD, follow the procedures in 14 CFR 39.19. Before using any approved AMOC on any airplane to which the AMOC applies, notify your principal maintenance inspector (PMI) or principal avionics inspector (PAI), as appropriate, or lacking a principal inspector, your local Flight Standards District Office. The AMOC approval letter must specifically reference this AD.

(3) AMOCs approved previously in accordance with AD 2008-04-11, Amendment 39-15383, are approved as AMOCs for the corresponding provisions of this AD.

#### Material Incorporated by Reference

(k) You must use Boeing 707/720 Airworthiness Limitations (AWLs) Document D6-7552-AWL, including attachment, dated March 2006, to do the actions required by this AD, unless the AD specifies otherwise.

(1) The Director of the Federal Register previously approved the incorporation by reference of Boeing 707/720 Airworthiness Limitations (AWLs) Document D6-7552-AWL, including attachment, dated March 2006, on March 28, 2008 (73 FR 9666, February 22, 2008).

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, Washington 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; e-mail [me.boecom@boeing.com](mailto:me.boecom@boeing.com); Internet <https://www.myboeingfleet.com>.

(3) You may review copies of the service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, Washington. For information on the availability of this material at the FAA, call 425-227-1221 or 425-227-1152.

(4) You may also review copies of the service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

Issued in Renton, Washington, on December 16, 2009.

Stephen P. Boyd,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. E9-30564 Filed 12-24-09; 8:45 am]

BILLING CODE 4910-13-P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2009-0987; Directorate Identifier 2009-CE-054-AD; Amendment 39-16143; AD 2009-26-08]

RIN 2120-AA64

#### Airworthiness Directives; AeroSpace Technologies of Australia Pty Ltd Models N22B, N22S, and N24A Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are superseding an existing airworthiness directive (AD) for the products listed above. This AD results from mandatory continuing airworthiness information (MCAI) issued by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

Late in 2002 the manufacturer advised CASA of another Nomad accident which was possibly caused by aileron flutter with the flaps at 38 degrees. This, along with the other flutter incidents, has resulted in the manufacturer issuing ANMD-57-18 Issue 1 as a precautionary measure while they further investigate the issue.

The manufacturer has now completed their investigation and issued Alert Service Bulletin ANMD-27-53 to modify flap actuation linkages to restore the necessary rigidity to the outboard flap, and hence the aileron. The unacceptable flexibility of the outboard flap mechanism allows flutter to occur in extreme circumstances.

We are issuing this AD to require actions to correct the unsafe condition on these products.

**DATES:** This AD becomes effective February 1, 2010.

On February 1, 2010, the Director of the Federal Register approved the incorporation by reference of Nomad Alert Service Bulletin ANMD-27-53, dated February 20, 2008, listed in this AD.

As of November 8, 2006 (71 FR 61636, October 19, 2006), the Director of the Federal Register approved the

incorporation by reference of Nomad Alert Service Bulletin ANMD-57-18, Rev 1, dated August 14, 2006, listed in this AD.

**ADDRESSES:** You may examine the AD docket on the Internet at <http://www.regulations.gov> or in person at the Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

**FOR FURTHER INFORMATION CONTACT:** Doug Rudolph, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, ACE-112, Kansas City, Missouri 64106; telephone: (816) 329-4059; fax: (816) 329-4090; e-mail: [doug.rudolph@faa.gov](mailto:doug.rudolph@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an AD that would apply to the specified products. That NPRM was published in the **Federal Register** on October 22, 2009 (74 FR 54498), and proposed to supersede AD 2006-21-12, Amendment 39-14797 (71 FR 61636, October 19, 2006). That NPRM proposed to correct an unsafe condition for the specified products. The MCAI states that:

Late in 2002 the manufacturer advised CASA of another Nomad accident which was possibly caused by aileron flutter with the flaps at 38 degrees. This, along with the other flutter incidents, has resulted in the manufacturer issuing ANMD-57-18 Issue 1 as a precautionary measure while they further investigate the issue.

The manufacturer has now completed their investigation and issued Alert Service Bulletin ANMD-27-53 to modify flap actuation linkages to restore the necessary rigidity to the outboard flap, and hence the aileron. The unacceptable flexibility of the outboard flap mechanism allows flutter to occur in extreme circumstances.

This amendment mandates Alert Service Bulletin ANMD-27-53, which requires modifications to the aircraft, but terminates the limitations imposed by earlier amendments.

#### Comments

We gave the public the opportunity to participate in developing this AD. We received no comments on the NPRM or on the determination of the cost to the public.

#### Conclusion

We reviewed the available data and determined that air safety and the public interest require adopting the AD as proposed.