

(a) *Size of concerns.* A joint venture of at least one WOSB EDWOSB and one or more other business concerns may submit an offer as a small business for a competitive WOSB or EDWOSB procurement so long as each concern is small under the size standard corresponding to the NAICS code assigned to the procurement;

* * * * *

(d) The joint venture must comply with the limitations on subcontracting, as required by § 125.6 of this chapter;

* * * * *

Dated: December 10, 2014.

Maria Contreras-Sweet,
Administrator.

[FR Doc. 2014–29753 Filed 12–24–14; 8:45 am]

BILLING CODE 8025–01–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2014–0929; Directorate Identifier 2014–NM–118–AD]

RIN 2120–AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 767 airplanes. This proposed AD was prompted by reports that six fasteners may not have been installed in the left and right stringer 37 (S–37) between body station (BS) 428 and 431 lap splices on certain airplanes. This proposed AD would require a general visual inspection of S–37 lap splices for missing fasteners; and all applicable related investigative and corrective actions. We are proposing this AD to detect and correct missing fasteners, which could result in cracks in the fuselage skin that could adversely affect the structural integrity of the airplane. **DATES:** We must receive comments on this proposed AD by February 12, 2015. **ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202–493–2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M–

30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.

• *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P. O. Box 3707, MC 2H–65, Seattle, WA 98124–2207; telephone 206–544–5000, extension 1; fax 206–766–5680; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2014–0929; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800–647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Berhane Alazar, Aerospace Engineer, Airframe Branch, ANM–120S, FAA, Seattle Aircraft Certification Office (ACO), 1601 Lind Avenue SW., Renton, WA 98057–3356; phone: 425–917–6590; fax: 425–917–6590; email: Berhane.Alazar@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA–2014–0929; Directorate Identifier 2014–NM–118–AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any

personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

We received reports that six fasteners may not have been installed in the left and right stringer 37 (S–37) between BS 428 and 431 lap splices on certain airplanes during production. This condition, if not corrected, could result in cracks in the fuselage skin that could adversely affect the structural integrity of the airplane.

Relevant Service Information

We reviewed Boeing Alert Service Bulletin 767–53A0251, dated August 7, 2013. For information on the procedures and compliance times, see this service information at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2014–0929.

FAA’s Determination

We are proposing this AD because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of these same type designs.

Proposed AD Requirements

This proposed AD would require accomplishing the actions specified in the service information described previously, except as discussed under “Differences Between this Proposed AD and the Service Information.”

The phrase “related investigative actions” is used in this proposed AD. “Related investigative actions” are follow-on actions that (1) are related to the primary action, and (2) further investigate the nature of any condition found. Related investigative actions in an AD could include, for example, inspections.

The phrase “corrective actions” is used in this proposed AD. “Corrective actions” are actions that correct or address any condition found. Corrective actions in an AD could include, for example, repairs.

Explanation of “RC” Steps in Service Information

The FAA worked in conjunction with industry, under the Airworthiness Directives Implementation Aviation Rulemaking Committee, to enhance the AD system. One enhancement was a new process for annotating which steps in the service information are required for compliance with an AD. Differentiating these steps from other tasks in the service information is

expected to improve an owner's/operator's understanding of crucial AD requirements and help provide consistent judgment in AD compliance. The actions specified in the service information described previously include steps that are labeled as RC (required for compliance) because these steps have a direct effect on detecting, preventing, resolving, or eliminating an identified unsafe condition.

As noted in the specified service information, steps labeled as RC must be done to comply with the proposed AD. However, steps that are not labeled as RC are recommended. Those steps that are not labeled as RC may be deviated from, done as part of other actions, or

done using accepted methods different from those identified in the service information without obtaining approval of an alternative method of compliance (AMOC), provided the steps labeled as RC can be done and the airplane can be put back in a serviceable condition. Any substitutions or changes to steps labeled as RC will require approval of an AMOC.

Differences Between This Proposed AD and the Service Information

Boeing Alert Service Bulletin 767–53A0251, dated August 7, 2013, specifies to contact the manufacturer for instructions on how to repair certain conditions, but this proposed AD would

require repairing those conditions in one of the following ways:

- In accordance with a method that we approve; or
- Using data that meet the certification basis of the airplane, and that have been approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) whom we have authorized to make those findings.

Costs of Compliance

We estimate that this proposed AD affects 23 airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
General visual inspection	1 work-hour × \$85 per hour = \$85	\$0	\$85	\$1,955

We estimate the following costs to do any necessary inspections/installations that would be required based on the

results of the proposed inspection. We have no way of determining the number

of aircraft that might need these inspections/installations:

ON-CONDITION COSTS

Action	Labor cost	Parts cost	Cost per product
Detailed and high frequency eddy current inspections and fastener installation.	13 work-hours × \$85 per hour = \$1,105	\$0	\$1,105

We have received no definitive data that would enable us to provide cost estimates for the repairs specified in this proposed AD.

According to the manufacturer, some of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all costs in our cost estimate.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures

the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and

(4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. Amend § 39.13 by adding the following new airworthiness directive (AD):

The Boeing Company: Docket No. FAA–2014–0929; Directorate Identifier 2014–NM–118–AD.

(a) Comments Due Date

We must receive comments by February 12, 2015.

(b) Affected ADs

None.

(c) Applicability

This AD applies to The Boeing Company Model 767–200, –300, –300F, and –400ER series airplanes, certificated in any category, as identified in Boeing Alert Service Bulletin 767–53A0251, dated August 7, 2013.

(d) Subject

Air Transport Association (ATA) of America Code 53, Fuselage.

(e) Unsafe Condition

This AD was prompted by reports that six fasteners may not have been installed in the left and right stringer 37 (S–37) between body station 428 and 431 lap splices on certain airplanes. We are issuing this AD to detect and correct missing fasteners, which could result in cracks in the fuselage skin that could adversely affect the structural integrity of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Inspections, Related Investigative Actions, and Corrective Actions

Except as provided by paragraph (h)(2) of this AD, at the applicable time specified in paragraph 1.E., “Compliance,” of Boeing Alert Service Bulletin 767–53A0251, dated August 7, 2013: Do an external general visual inspection of the S–37 lap splice for missing fasteners, and do all applicable related investigative and corrective actions; in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 767–53A0251, dated August 7, 2013, except as provided by paragraph (h)(1) of this AD. Do all applicable related investigative and corrective actions before further flight.

(h) Exceptions to Service Information Specifications

(1) Where Boeing Alert Service Bulletin 767–53A0251, dated August 7, 2013, specifies to contact Boeing for repair instructions: Before further flight, do the repair using an FAA-approved method.

(2) Where Paragraph 1.E., “Compliance,” of Boeing Alert Service Bulletin 767–53A0251, dated August 7, 2013, specifies a compliance time “after the original issue date of this service bulletin,” this AD requires compliance within the specified compliance time after the effective date of this AD.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19,

send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO, to make those findings. For a repair method to be approved, the repair must meet the certification basis of the airplane and the approval must specifically refer to this AD.

(4) Except as required by paragraph (h)(1) of this AD: If the service information contains steps that are labeled as RC, those steps must be done to comply with this AD; any steps that are not labeled as RC are recommended. Those steps that are not labeled as RC may be deviated from, done as part of other actions, or done using accepted methods different from those identified in the specified service information without obtaining approval of an AMOC, provided the steps labeled as RC can be done and the airplane can be put back in a serviceable condition. Any substitutions or changes to steps labeled as RC require approval of an AMOC.

(j) Related Information

(1) For more information about this AD, contact Berhane Alazar, Aerospace Engineer, Airframe Branch, ANM–120S, FAA, Seattle Aircraft Certification Office (ACO), 1601 Lind Avenue SW., Renton, WA 98057–3356; phone: 425–917–6590; fax: 425–917–6590; email: Berhane.Alazar@faa.gov.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P. O. Box 3707, MC 2H–65, Seattle, WA 98124–2207; telephone 20–544–5000, extension 1; fax 206–766–5680; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on December 17, 2014.

Michael Kaszycki,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2014–30271 Filed 12–24–14; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2014–0928; Directorate Identifier 2014–NM–040–AD]

RIN 2120–AA64

Airworthiness Directives; Airbus Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for all Airbus Model A330–200 Freighter, A330–200, A330–300, A340–200, A340–300, A340–500, and A340–600 series airplanes. This proposed AD was prompted by a report of skin disbonding on a composite side panel of a rudder installed on an A310 airplane. This proposed AD would require a review of the maintenance records of the rudder to determine if any composite side shell panel repair has been done; a thermography inspection limited to the repair areas or complete side shells, as applicable, to identify possible in-service rudder repairs, damages, or fluid ingress; and applicable related investigative and corrective actions. We are proposing this AD to detect and correct the rudder skin disbonding, which could affect the structural integrity of the rudder, and could result in reduced controllability of the airplane.

DATES: We must receive comments on this proposed AD by February 12, 2015.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- **Fax:** 202–493–2251.
- **Mail:** U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- **Hand Delivery:** U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Airbus SAS, Airworthiness Office—EAL, 1 Rond Point Maurice Bellonte, 31707 Blagnac